

SEVEN MILE: INSTALLED 1986

Riser No.	Material Changes Since Original Installation
1	None
2	Plugged 1" hole in top steel riser section (12/10 per WW-22-10). Very small leak in repair per 2012 inspection (5/12).
3	None
4	None
5	Replaced top 5' Section w/FRP (11/04 per SER-25-04)
6	None
7	Replaced top 5' Section w/FRP (11/04 per SER-25-04)
8	None
9	½" hole in riser per 2012 inspection (5/12); ¼" hole in riser per 2013 inspection (7/13); Replaced w/ HDPE (2/18 per WW-27-17-REBID)
10	Replaced w/ HDPE (2/18 per WW-27-17-REBID)
11	Replaced w/ HDPE (2/18 per WW-27-17-REBID)
12	Replaced w/ HDPE (2/18 per WW-27-17-REBID)
13	None - Leak at breakaway flange per 2019 inspection (6/19)
14	None
15	None
16	None
17	Missing (per 2020 inspection); Replaced w/HDPE (7/21 per WW-19-21)
18	Replaced w/Steel (1/02 per Quote)
19	Replaced w/Blind Flange (1/02 per Quote); Replaced w/FRP (11/04 per SER-25-04); Replaced w/ HDPE (2/18 per WW-27-17-REBID); Replaced w/HDPE (7/21 per WW-19-21)
20	None
21	None
22	None
23	None
24	None
25	None
26	None
27	None
28	Replaced top 5' Section w/FRP (11/04 per SER-25-04)
29	1¼" x 3" hole in southern diffuser arm per 2012 inspection (5/12).
30	None
31	None
32	None
33	None
34	None
35	None
36	None
37	None
38	Replaced w/ HDPE (9/07 per WW-23-07)
39	None
C.O.	None